





SERVICE BULLETIN	
Product:	Dishwasher
Bulletin Number	ASC20151026002
Bulletin Date:	4/20/2016
Models:	DW80H9930US/AA, DW80H9940US/AA, DW80H9950US/AA, DW80H9970US/AA, DW80J9945US/AA, DW80J7550UG/AA, DW80J7550US/AA, DW80J7550UW/AA

SUBJECT: Water leak from corners of dishwasher, version 00




Issue: If the Assy Vane is not fully connected to the Assy Motion, water from the Assy Nozzle-Lower can miss the Assy Vane and cause a leak.

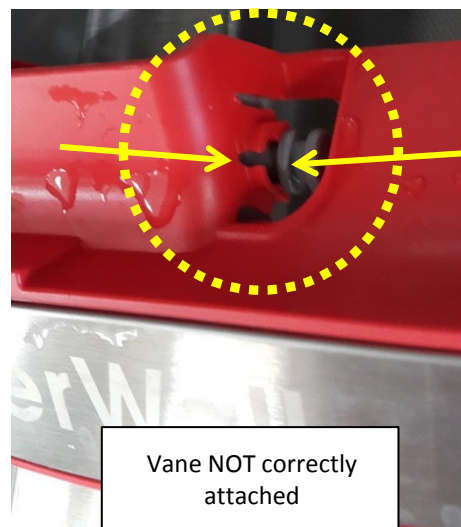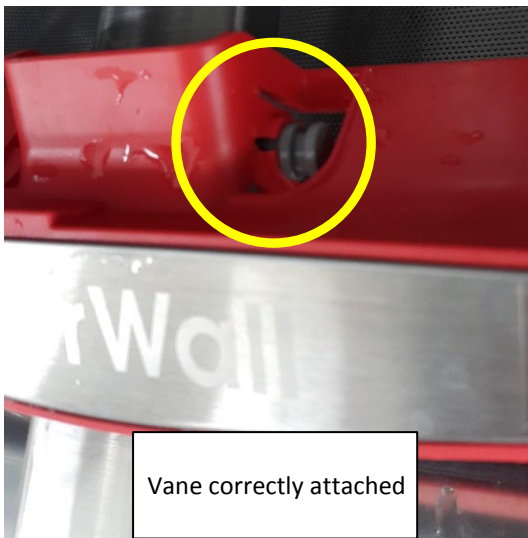

This information is published for informational purposes only and intended for use only by personnel qualified for the specific tasks depicted. Qualified personnel are those who, based on their training and experience, are capable of identifying risks and avoiding potential hazards when handling or servicing a product. Only qualified personnel should repair products powered by electricity. Any attempt to handle, service or repair the product or products by anyone other than qualified personnel could result in serious injury or death. You agree that your use of and reliance on this information is at your sole risk. This information is subject to change or update without notice. There are no warranties, either expressed or implied, regarding the accuracy or completeness of this information.

Solution: Replace the Assy Vane, part number DD97-00206B. The new Assy Vane has increased hook strength to prevent accidental separation of the vane.

Important Note: This service bulletin **does not** apply to Version 01 WaterWall dishwashers. Version 01 starts at serial number **0CN1GDAG900514D**. See Service Bulletin ASC20161026001 for details. Please see the chart on the next page to interpret production dates by serial number.

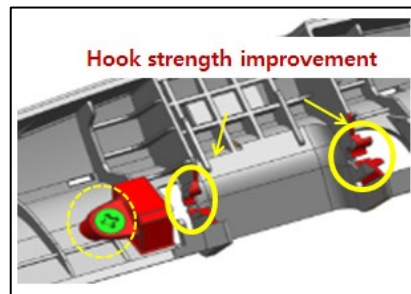

To attach the Assy Vane, follow the procedure below.



1. Place the water wall vane on the motion assembly.




2. Push down on the vane until you hear a "tick" sound.



3. Correctly installed vane.

This information is published for informational purposes only and intended for use only by personnel qualified for the specific tasks depicted. Qualified personnel are those who, based on their training and experience, are capable of identifying risks and avoiding potential hazards when handling or servicing a product. Only qualified personnel should repair products powered by electricity. Any attempt to handle, service or repair the product or products by anyone other than qualified personnel could result in serious injury or death. You agree that your use of and reliance on this information is at your sole risk. This information is subject to change or update without notice. There are no warranties, either expressed or implied, regarding the accuracy or completeness of this information.

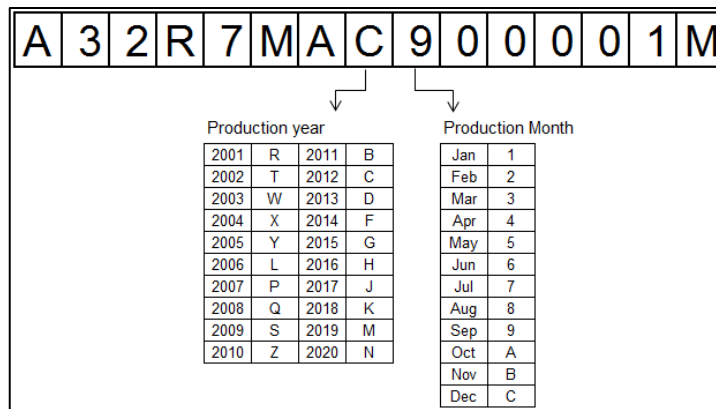

Symptom 1	Symptom 2	Symptom 3	Symptom 4
Operation	Water Leak	From the Door	

Note: Consult the Samsung Service Website at (<http://.service.samsungportal.com>) for the Service Manual and other information on this product.

This information is published for informational purposes only and intended for use only by personnel qualified for the specific tasks depicted. Qualified personnel are those who, based on their training and experience, are capable of identifying risks and avoiding potential hazards when handling or servicing a product. Only qualified personnel should repair products powered by electricity. Any attempt to handle, service or repair the product or products by anyone other than qualified personnel could result in serious injury or death. You agree that your use of and reliance on this information is at your sole risk. This information is subject to change or update without notice. There are no warranties, either expressed or implied, regarding the accuracy or completeness of this information.