


Title	Water spills out of the drum intermittently during the “Deep Wash” cycle.		
Create Date	June 16, 2017	Service Bulletin Number	ASC20170616001
Revision Date		Model	WA45M7050AW/A4
Symptom	Operation	Deep Wash Cycle	Water Leaks

Issue / Symptoms:

Water spills out of the holes in the top of the drum or the tub cover intermittently during the “Deep Wash” cycle.

Repair Method:

The firmware has been modified to resolve this issue. **Replace the Main PBA and Sub PBA** (Replacement part: Assy Kit DC92-01623G).

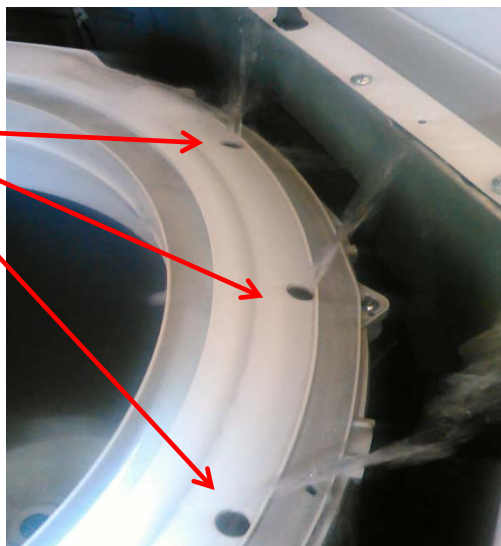

Part Affected	Affected Serial Number Range	How to check the serial number
ASSY KIT (Main PBA and Sub PBA)	Production range: January through June, 2017. The 8 th and 9 th digits in the Serial Number are J1, J2, J3, J4, J5 and J6 .	

How to check the production month by serial number

Digit	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15
(Ex)	0	A	S	V	5	B	A	J	2	1	2	3	4	5	A

CODE	YEAR
D	2013
F	2014
G	2015
H	2016
J	2017

CODE	MONTH
1	Jan
2	Feb
3	Mar
4	Apr
5	May
6	Jun
7	Jul
8	Aug
9	Sep
A	Oct
B	Nov
C	Dec

*** Units produced in July, 2017 or later are not affected**

Affected Models / Replacement Part Information:

PRODUCT	MODEL	SVC PARTS CODE	SVC PARTS NAME
Top-loaded Washer	WA45M7050AW/A4	DC92-01623G	ASSY KIT (Main PBA and Sub PBA)

Note: Replace the complete assembly (both Main and Sub PBAs.)

Check the Firmware Version After Replacing the Main PBA and Sub PBA



After you have replaced the Main PBA and Sub PBA, you must enter the Code Information Display Mode to confirm that the software version is correct (t511 or higher).

To enter the Code Information Display Mode, follow these steps:

- 1) Turn on the **power**.
- 2) Press **Delay end** until **17h** appears.
- 3) Press and hold **Start** until **AS** appears.
- 4) Press and hold **Temp** to display the **s/w version (t511 or higher)**.

✖CAUTION: After replacing the Main and Sub PBA, you must confirm that the firmware is version t511 or higher.

This information is published for informational purposes only and intended for use only by personnel qualified for the specific tasks depicted. Qualified personnel are those who, based on their training and experience, are capable of identifying risks and avoiding potential hazards when handling or servicing a product. Only qualified personnel should repair products powered by electricity. Any attempt to handle, service or repair the product or products by anyone other than qualified personnel could result in serious injury or death. You agree that your use of and reliance on this information is at your sole risk. This information is subject to change or update without notice. There are no warranties, either expressed or implied, regarding the accuracy or completeness of this information.