

Title	Cavity Floor Cracking on Gas Oven Range Models		
Create Date	March 10 th , 2017	Service Bulletin Number	ASC20170310001
Revision Date		Models	All Gas Range Models
Symptom	Design	Interior Design/Damaged/Discolor	Cavity Damage

Affected Units:


Model

All Models

Production Date


Produced Prior to February 2017

How to determine the production date from the serial number:

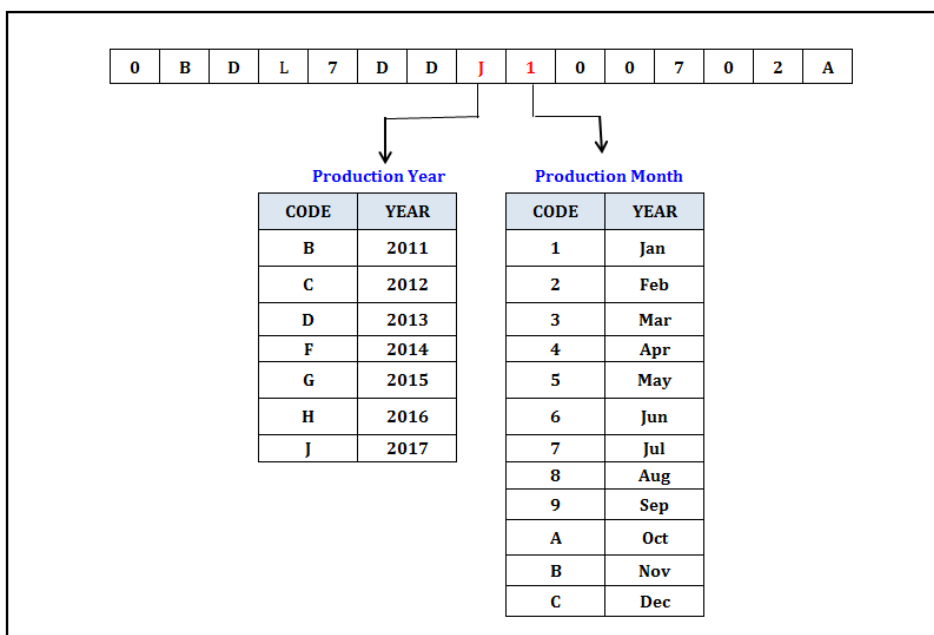

Issue:


If the bake spreader comes in direct contact with the floor panel, over time, the oven floor coating may start to crack and peel.

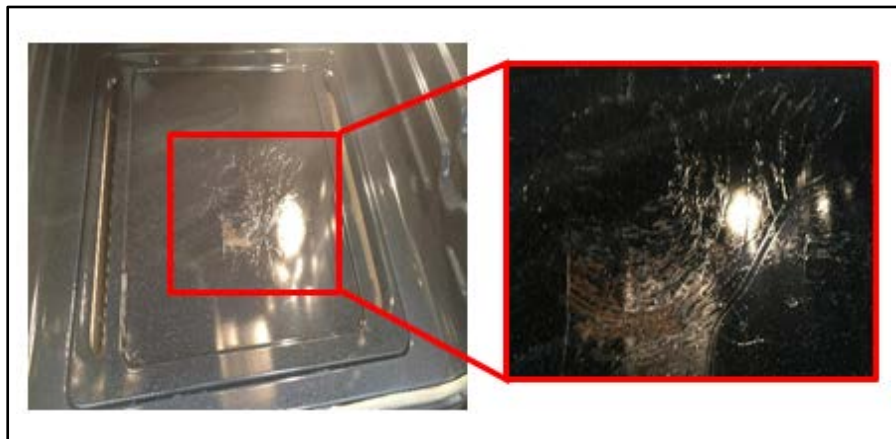

Repair Method:

The bake spreader has been modified to prevent contact with the floor panel. To resolve the issue, replace the bake spreader and the floor panel.

Parts Information:

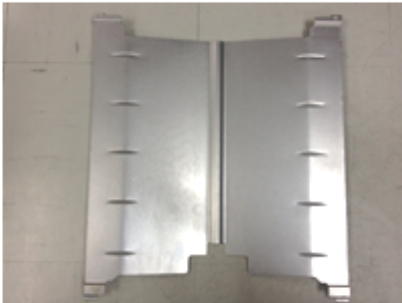Part Name	Part Number	Part Image
CAVITY FLOOR COATING	DG61-00570A	
BRACKET-BAKE SPEADER	DG61-00523A	

This information is published for informational purposes only and intended for use only by personnel qualified for the specific tasks depicted. Qualified personnel are those who, based on their training and experience, are capable of identifying risks and avoiding potential hazards when handling or servicing a product. Only qualified personnel should repair products powered by electricity. Any attempt to handle, service or repair the product or products by anyone other than qualified personnel could result in serious injury or death. You agree that your use of and reliance on this information is at your sole risk. This information is subject to change or update without notice. There are no warranties, either expressed or implied, regarding the accuracy or completeness of this information.