



SERVICE BULLETIN	
Product:	Microwave
Bulletin Number	ASC20150122001
Bulletin Date:	1/22/2016
Models:	ME179KFETSR/AA, MC17F808KDT/AA

SUBJECT: Engineering change to the main PCB and control panel.

Background: To improve touch panel performance, an engineering change to the main PCB and the control panel were made.

Solution: If the Control Box Assembly, Control Panel Assembly, or the Main PCB Assembly fails on the ME179KFETSR/AA or the MC17F808KDT/AA version 00 microwave, **replace the Control Box Assembly with Control Box Assembly DE94-02944E**. If the Control Box Assembly, Control Panel Assembly, or the Main PCB Assembly fails on a MC17F808KDT/AA version 01, replace the individual components with the parts listed under Service Part below (in light blue).


Model Code	Engineering Change	Defective part		Service Part	
		Part Desc.	Part Code	Part Desc.	Part Code
ME179KFETSR/AA	N/A	Assy C/Box	DE94-02944A	Assy C/Box	DE94-02944E
		Assy C/Panel	DE94-02948A		
		Assy PCB MAIN	DE92-03064A		
MC17F808KDT/AA	Version 00	Assy C/Box	DE94-02944C	Assy C/Box	DE94-02944E
		Assy C/Panel	DE94-02948B		
		Assy PCB MAIN	DE92-03064C		
	Version 01	Assy C/Box	DE94-02944E	Assy C/Box	DE94-02944E
		Assy C/Panel	DE94-02948C	Assy C/Panel	DE94-02948C
		Assy PCB MAIN	DE92-03064E	ASSY PCB MAIN	DE92-03064E

Important Note:

Please note that the Control Box Assembly (DE94-02944E) will be different than the original Control Box Assembly (DE94-02944A) on the ME179KFETSR/AA. The Smart Chef feature on the ME179 Control Box will be the Fit Choice Feature. In addition, the Slim Fry feature will be added. Please see the following graphic for more detail. A sheet will be provided with Control Box Assembly (DE94-02944E) to instruct the customer on how to use the Slim Fry feature.

This information is published for informational purposes only and intended for use only by personnel qualified for the specific tasks depicted. Qualified personnel are those who, based on their training and experience, are capable of identifying risks and avoiding potential hazards when handling or servicing a product. Only qualified personnel should repair products powered by electricity. Any attempt to handle, service or repair the product or products by anyone other than qualified personnel could result in serious injury or death. You agree that your use of and reliance on this information is at your sole risk. This information is subject to change or update without notice. There are no warranties, either expressed or implied, regarding the accuracy or completeness of this information

ME179KEFTSR Control Design

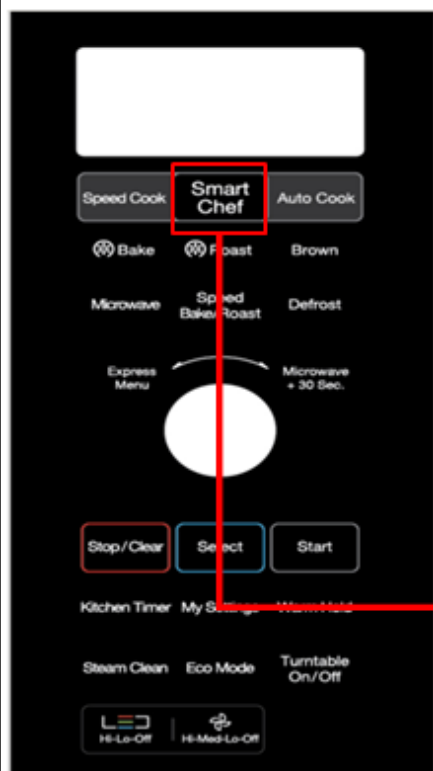

MC17F808KDT Control Design



"Slim Fry" function is added



ICON change
"Smart Chef" → "Fit Choice"

Symptom 1	Symptom 2	Symptom 3	Symptom 4
Operation	Control	Button does not respond	

Note: Consult the Samsung Service Website at (<http://service.samsungportal.com>) for the Service Manual and other information on this product.

This information is published for informational purposes only and intended for use only by personnel qualified for the specific tasks depicted. Qualified personnel are those who, based on their training and experience, are capable of identifying risks and avoiding potential hazards when handling or servicing a product. Only qualified personnel should repair products powered by electricity. Any attempt to handle, service or repair the product or products by anyone other than qualified personnel could result in serious injury or death. You agree that your use of and reliance on this information is at your sole risk. This information is subject to change or update without notice. There are no warranties, either expressed or implied, regarding the accuracy or completeness of this information